

# RF-Capacitance /Admittance Level Switch
















































### PRODUCT INTRODUCTION

### PRODUCT DESCRIPTION

RF-Capacitance /Admittance level switch is appropriate for application in liquid and solid mediums. It is designed to reduce medium attaching to the probe. This product also offers DPDT output, high/low level failsafe, adjustable time delay, and sensitivity adjustment. Various models are available for high temperature, or limited space environments.

### **FEATURES**

- Time delay function from 0-30 seconds
- IP65 housing protection
- 5 A/250Vac output DPDT
- High/low failsafe
- Alarm testing
- Explosion Proof model available

### **WORKING PRINCIPLE**

RF-Capacitance / Admittance level switch consists of a guard section, upper insulation, main probe and grounding. The guard section is designed to overcome possible medium attachment and to secure signal accuracy. The special structure is suitable for detecting different mediums without being affected by attachments.

The upper main probe, guard, and grounding are all insulated. The level of the medium can be detected by the increasing of admittance when medium reaches the main probe.

The grounding and the main probe are insulated, thus the device will still function accurately and not cause false alarms when the medium attaches the probe.

# Radio frequency is applied to active section Grounding Guard Section Upper Insulation Active section Radio frequency is applied to the main probe Build up

### **FEATURES**


- Anti-Viscosity
- Easy Installation
- · Stable; not affected by temperature
- Highest temperature tolerance of 550°C
- Explosion-proof 450°C
- Applicable in liquid, syrup, solid, powder,and surface level detection

### **CONSTRUCTION & APPLICATION**

### CONSTRUCTION

- 1. Main probe: SUS304 or SUS316
- Upper Insulation: The upper insulated part of the main probe and guard section have very low k dielectric constants and are made of PTFE or PEFK
- Guard Section: The conductive metal probe helps to dissipate any possible presence of a false signal.
- Lower Insulation: Due to the low k die-electric constant nature of the main probe, it is comprised of PTFE


- 5. Connection: 3/4"NPT(Standard model)
- 6. Housing: Aluminum alloy spray paint
- 7. Wiring point: 1/2" PT
- 8. Waterproof O-Ring: Rubber
- Circuitry: FSH and FSL, Time delay adjustable function

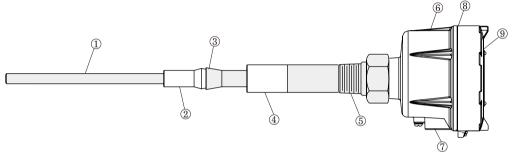

### **APPLICATION**

Storage Tanks, Containers, Wells, Reservoirs and bins containing any liquids, powders or pellets that require precise level detection and control. Key industries include:

- Breweries
- Mining
- Paint manufacturing plant
- Coal
- · Food processing
- Flour mills
- · Glass Industry
- Plastics processing, polymers and synthetics
- Chemical
- Paper manufacturing
- Power plants
- Water and waste water treatment plant
- Tar
- Food and beverage

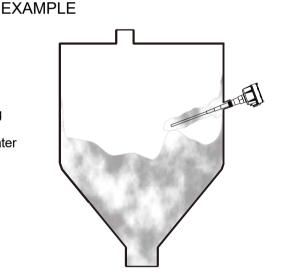

2100/2110: Standard model ---- Applicable to normal environments.

2200: Hi-Temperature model -----Applicable to high temperature environments.

2280: Super Hi-Temperature model -----Applicable to super high temperature environments.

2500: Cable model -----Applicable to big tank and top installation environments.


2600: Mini model -----Applicable to space constraint and small tanks.

1799: Explosion proof type ---- Ex d IIB T6~T1

### CAUTION!


When the environment is with heavy dust blowing, especially for small sized bin (diameter<Ø1m, cubic meter<1.5m3) and the dust will become thicker in the air. The change of capacitance value between dusty air and materials will become too close to influence the measurement. So we will suggest to use SCX series, tuning fork level switch or SEX series, rotary paddle level switch as better solutions for this kind of scenario.

### **SPECIFICATIONS**

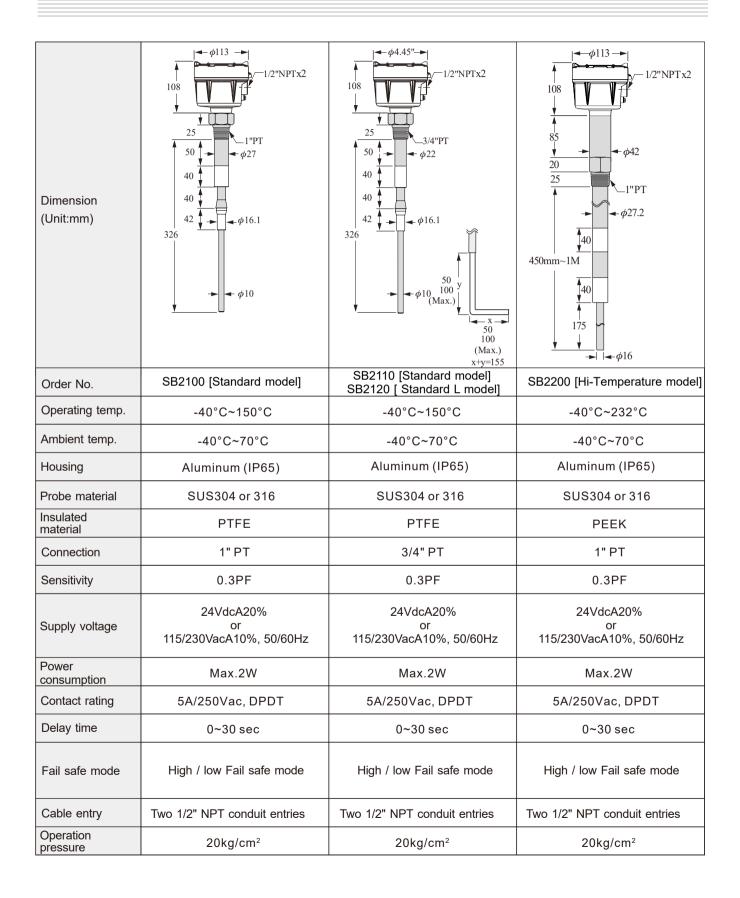

Dimension (Unit:mm)	200 200 200 200 200 4 580 25 38 4 20 4 20 20 20 20 20 20 20 20 20 20	$-\phi$ 113 — 1/2"NPTx2  108 — 1"PT — $\phi$ 27 — $\phi$ 28 — $\phi$ 28	-φ113 - 1/2"NPTx2  108 -3/4"PT -3/4"PT -60 -φ21.6 -φ16
Order No.	SB2280 [Super Hi-Temp Model]	SB2500 [Cable Model]	SB2600 [Mini Model]
Operating temp.	-40°C~550°C	-40°C~150°C	-40°C~150°C
Ambient temp.	-40°C~70°C	-40°C~70°C	-40°C~70°C
Housing	Aluminum (IP65)	Aluminum (IP65)	Aluminum (IP65)
Probe material	SUS304 or 316	SUS304 or 316	SUS304 or 316
Insulated material	Ceramic	PTFE	PTFE
Connection	1-1/4" PT	1" PT	3/4" PT
Sensitivity	0.3PF	0.3PF	0.3PF
Supply voltage	24VdcA20% or 115/230VacA10%, 50/60Hz	24VdcA20% or 115/230VacA10%, 50/60Hz	24VdcA20% or 115/230VacA10%, 50/60Hz
Power Consumption	Max.2W	Max.2W	Max.2W
Contact rating	5A/250Vac, DPDT	5A/250Vac, DPDT	5A/250Vac, DPDT
Delay time	0~30 sec	0~30 sec	0~30 sec
Fail safe mode	High / low Fail safe mode	High / low Fail safe mode	High / low Fail safe mode
Cable entry	Two 1/2" NPT conduit entries	Two 1/2" NPT conduit entries	Two 1/2" NPT conduit entries
Operation pressure	ATM	20kg/cm <sup>2</sup>	20kg/cm²

### **SPECIFICATION**

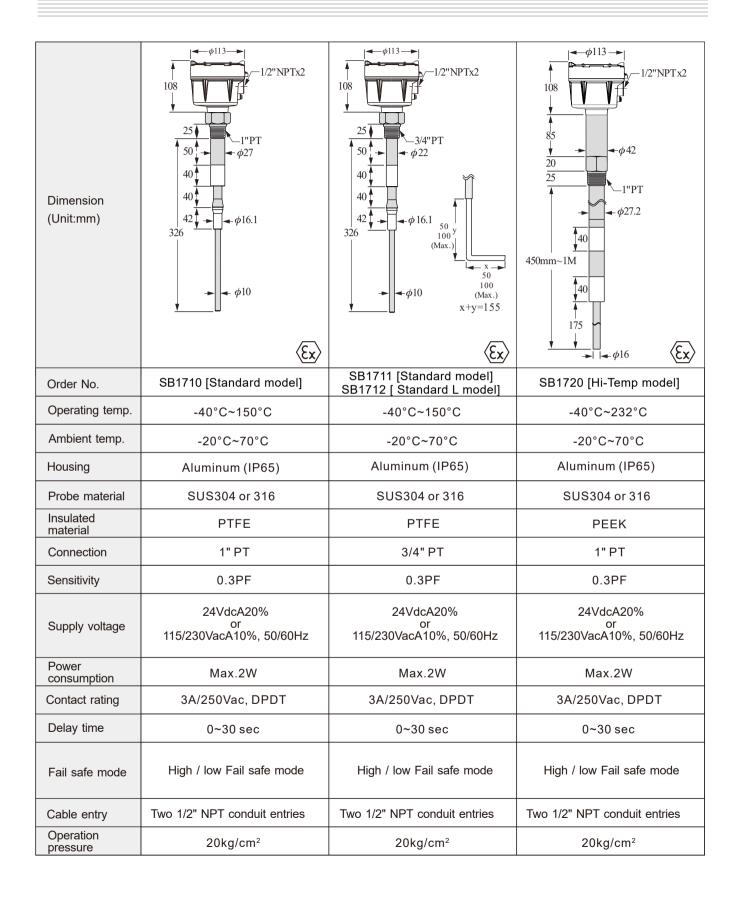



Dimension (Unit:mm)	200 220 220 200 4012.7	108 1/2"NPTx2  108 1/2"NPTx2	- φ113 - 1/2"NPTx2  108 - 3/4"PT - φ21.7 - 60 - φ21.6 - φ16
Order No.	SB1728 [Super Hi-Temp model]	SB1750 [Cable model]	SB1760 [Mini model]
Operating temp.	-40°C~450°C	-40°C~150°C	-40°C~150°C
Ambient temp.	-20°C~70°C	-20°C~70°C	-20°C~70°C
Housing	Aluminum (IP65)	Aluminum (IP65)	Aluminum (IP65)
Probe material	SUS304 or 316	SUS304 or 316	SUS304 or 316
Insulated material	Ceramic	PTFE	PTFE
Connection	1-1/4" PT	1" PT	3/4" PT
Sensitivity	0.3PF	0.3PF	0.3PF
Supply voltage	24VdcA20% or 115/230VacA10%, 50/60Hz	24VdcA20% or 115/230VacA10%, 50/60Hz	24VdcA20% or 115/230VacA10%, 50/60Hz
Power consumption	Max.2W	Max.2W	Max.2W
Contact rating	3A/250Vac, DPDT	3A/250Vac, DPDT	3A/250Vac, DPDT
Delay time	0~30 sec	0~30 sec	0~30 sec
Fail safe mode	High / low Fail safe mode	High / low Fail safe mode	High / low Fail safe mode
Cable entry	Two 1/2" NPT conduit entries	Two 1/2" NPT conduit entries	Two 1/2" NPT conduit entries
Operation pressure	ATM	20kg/cm²	20kg/cm <sup>2</sup>

### WIRING DIAGRAMS

### **DESCRIPTION OF PANEL FUNCTION**

- Set Point: A clockwise turn(H) will result in higher admittance and lower sensitivity, while a counter-clockwise turn(L) will result in lower admittance and higher sensitivity.
- 2 Red LED: When the LED is ON, it indicates power ON.
- Range: For (HI) high k die-electric material, ε>10 / For (LO) low k die-electric material.ε<10.
- FSH/FSL: (FSH) High level fail-safe alarm/(FSL) low level fail-safe alarm.
- 6 Green LED: Alarm (FSH) indicator is ON, it is empty; when it is OFF, it is loaded; Alarm (FSL) indicator is ON, it is loaded; when it is OFF, it is
- 6 Time Delay: Set the time delay of alarm output within 0~30 seconds. Turning clockwise (L) can set to a longer time, while turning counter-clockwise (S) can set to a shorter time.
- Analog test: Analog alarm test function, and terminal jumping switch function.
- Relay output: Connect terminal to load, command or control.
- Power input: Connect terminal to the power supply system.

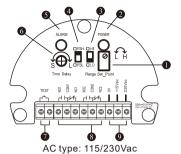

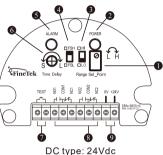

DC type: 24Vdc

### **FAILSAFE ALARM**

### FSH high level failsafe alarm

SB2 series switch is installed at the high level point the FSH switch mode is "on".

When the medium has no contact with the probe, the green LED lights up and relay output COM/NC is in an open state.

When the medium level reaches high level and it touches the probe (or in the case of blackout), the green LED turns off and the relay output COM/NC is closed. When the relay output COM/NC is closed, it implies the FSH alarm has been activated.

### ALARM CALIBRATION

Setting for High Level Alarm

- 1.Switch the FSH/FSL Knob to FSH
- 2.Switch the Range Knob to LO.
- 3. Switch the Time Delay Knob to S (Minimum).
- 4.Decrease the level of the medium to below the measuring probe.
- 5. Spin the set point knob till the Alarm LED (Green light) lights up.
- 6. Firstly, increas the level of the medium till it covers half of the measuring probe and the Alarm LED (green light) shut off. Secondly, spinning the Set Point Knob clockw ise till Alarm LED (green light) lights up. If the Alarm LED (green light) still does not lights up after spinning it till the end, please adjust the range switch to HI and repeat procedure 5. Thirdly, record the numbers of turns and its angle, then switch the knob counterclockwise back for 1/4 twist circle and angle.
- 7. Adjusting the delay time for alarm (0~30 seconds): If turning the time delay knob clockwise, the delay time is postponed, while turning the Time delay knob counterclockwise, the delay time is shortened.

### FSL low level failsafe alarm

SB2 series switch is installed at the low level, the FSL mode is "on".

When the medium touches the probe the green LED lights up and the relay output COM/NC is in an open

When the medium level drops below the low level and the medium does not have contact with the probe (or in the case of blackouts), the green LED turns off and relay output COM/NC is closed.

When relay output COM/NC is closed, it implies the FSI alarm has been activated

Setting for Low Level Alarm

- 1. Move the FSH/FSL button to FSL.
- 2. Move the 'range' button to LO.
- 3. Turn the 'time delay' knob to S (Minimum).
- 4. Lower the level of the medium to cover half of the measuring probe.
- 5. Turn the 'set point' screw counterclockwise till the Alarm LED lights up. If the LED hasn't lit up after turning it fully to the end, please adjust the 'range' button to HI and repeat procedure 5.
- 6. Now, decrease the level of the medium until it is below the measuring probe and the Alarm LED has turned off. Next, turn the 'set point' screw counterclockwise until the Alarm LED (green light) lights up [Recording the numbers of turns you make]. Finally, turn back the set point' screw clockwise for 3/4 twist circle.
- 7. Adjust the delay time for the alarm (0~30 seconds): When turning the 'time delay' knob clockwise, the delay time is postponed. Turning the 'time delay' knob counterclockwise, the delay time will be shortened.

## **MODEL NUMBER / ORDER CODE COMPARISON TABLE**


Model Number	Order Code
SB2100	SBX10000-A
SB2110	SBX10000-B
SB2120	SBX10000-D
SB2200	SBX10200-A
SB2280	SBX10800-C
SB2500	SBX10000-E
SB2600	SBX10000-F

Model Number	Order Code
SB1710	SBX1001C-A
SB1711	SBX1001C-B
SB1712	SBX1001C-D
SB1720	SBX1021C-A
SB1728	SBX1081C-C
SB1750	SBX1001C-E
SB1760	SBX1001C-F


### **ACCESSORIES**

Cable Conduit - Ex d IIC Material: Washer — NBR Body— Copper alloy(3/4"NPT) Nickel plated(1/2"NPT)


HP415-A23100MH01(29-1104)



HP415-A23000MG01(29-1108)




### ORDER INFORMATION

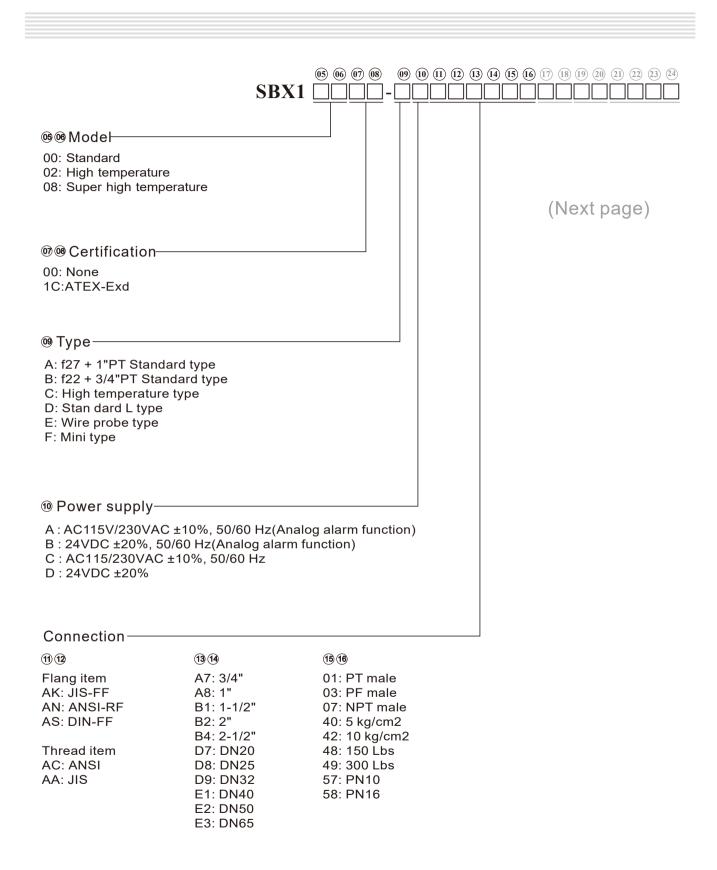

# **ORDER INFORMATION**

		SBX1	05 06	07 08 		(12) (1 	13 (14)	<u>(15)</u> (	16 (17	18	<u>(19)</u>	<b>20</b>	<u>21</u>	<u>22</u>	23 24
(1) (8) Probe m MA: SUS 304 MB: SUS 316 MC: SUS 316L															
13: PEEK 21: PTFE 32: Ceramics	d material ———														
21 22 23 24 Lengtl															
Code 0060~3000	Probe Length 0060~3000mm														

# **Global Network**

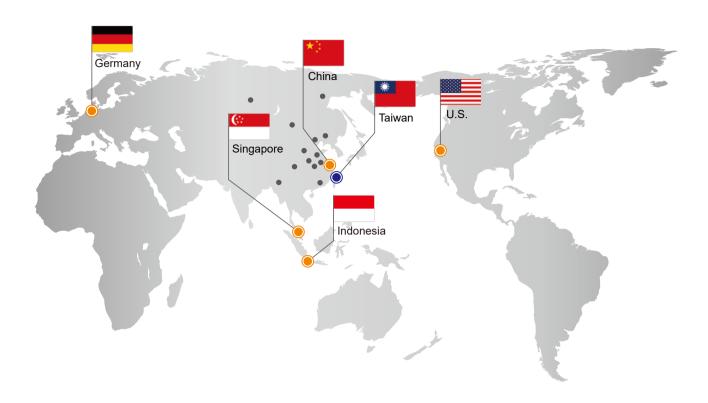

### Head Quarter

Taiwan

FineTek Co., Ltd. - Taipei Head Quarter No.16, Tzuchiang St., Tucheng Industrial Park New Taipei City 236, Taiwan

TEL: 886-2-2269-6789 FAX: 886-2-2268-6682 EMAIL: info@fine-tek.com

### Asia

China

Fine automation Co., Ltd. - Shanghai Factory No.451 DuHui Rd, MinHang District, Shanghai, China 201109

TEL: 86-21-6490-7260 EMAIL: info.sh@fine-tek.com

Singapore

FineTek Pte Ltd. - Singapore Office 37 Kaki Bukit Place, Level 4 Singapore 416215

TEL: 65-6452-6340 EMAIL: info.sg@fine-tek.com

PT. FineTek Automation Indonesia - Indonesia Office PERGUDANGAN TUNAS BITUNG JL. Raya Serang KM. 13,8, Blok C3 No. 12&15, Bitung Cikupa, Tangerang 15710 TEL: 62 (021)-2958-1688

EMAIL: info.id@fine-tek.com

### North America

California, U.S.

Aplus Finetek Sensor Inc. - US Office 355 S. Lemon Ave, Suite D Walnut, CA 91789

TEL: 1 909 598 2488 FAX: 1 909 598 3188 EMAIL: info@aplusfine.com

### Europe

Germany

FineTek GmbH - Germany Office Bei den Kämpen 26 21220 Seevetal-Ramelsloh, Germany

TEL: +49-(0)4185-8083-12 FAX: +49-(0)4185-8083-80 EMAIL: info@fine-tek.de

Mütec Instruments GmbH - Germany Office Bei den Kämpen 26

21220 Seevetal-Ramelsloh, Germany





Distributor:		